

USHER ENTERPRISES, INC

9865 NW 307TH AVE., P.O. BOX 511

NORTH PLAINS, OR 97133

(503) 647-0015 FAX: (503) 647 - 1015

E-mail: usher@acsip.com


FOR PROPER FUNCTION: IF CAP BECOMES DIFFICULT TO LATCH, LUBRICATE BOTH O-RINGS AND ALL MOVING PARTS.

FOR TENSION ADJUSTMENTS:

1. LOOSEN JAM NUT #90. TENSION ADJUSTMENTS ARE MADE WITH WASHER #83A, WHICH IS THREADED.
2. **TO TIGHTEN**, ROTATE PART # 83A CLOCKWISE AN 1/8" THEN TEST LATCH.
TO LOOSEN, ROTATE # 83A COUNTER-CLOCKWISE AN 1/8" THEN TEST LATCH.
***A SMALL ROTATION OF 1/8" MAKES A LARGE ADJUSTMENT IN THE TENSION ON THE LATCH. ADJUST THE TENSION IN THE LATCH SO THAT THE LATCH JUST SNAPS OVER CENTER. DO NOT OVERTIGHTEN!

REPLACE O-RINGS ANNUALLY OR AS NEEDED. OTHER PARTS IF WORN. DAMAGED PARTS WILL CAUSE LOSS OF SEAL AND OR LOSS OF CAP.

USE UD-3 FUEL CAP ORDER FORM FOR REPLACEMENT PARTS TO MAINTAIN PROPER FUNCTION OF FUEL CAPS.

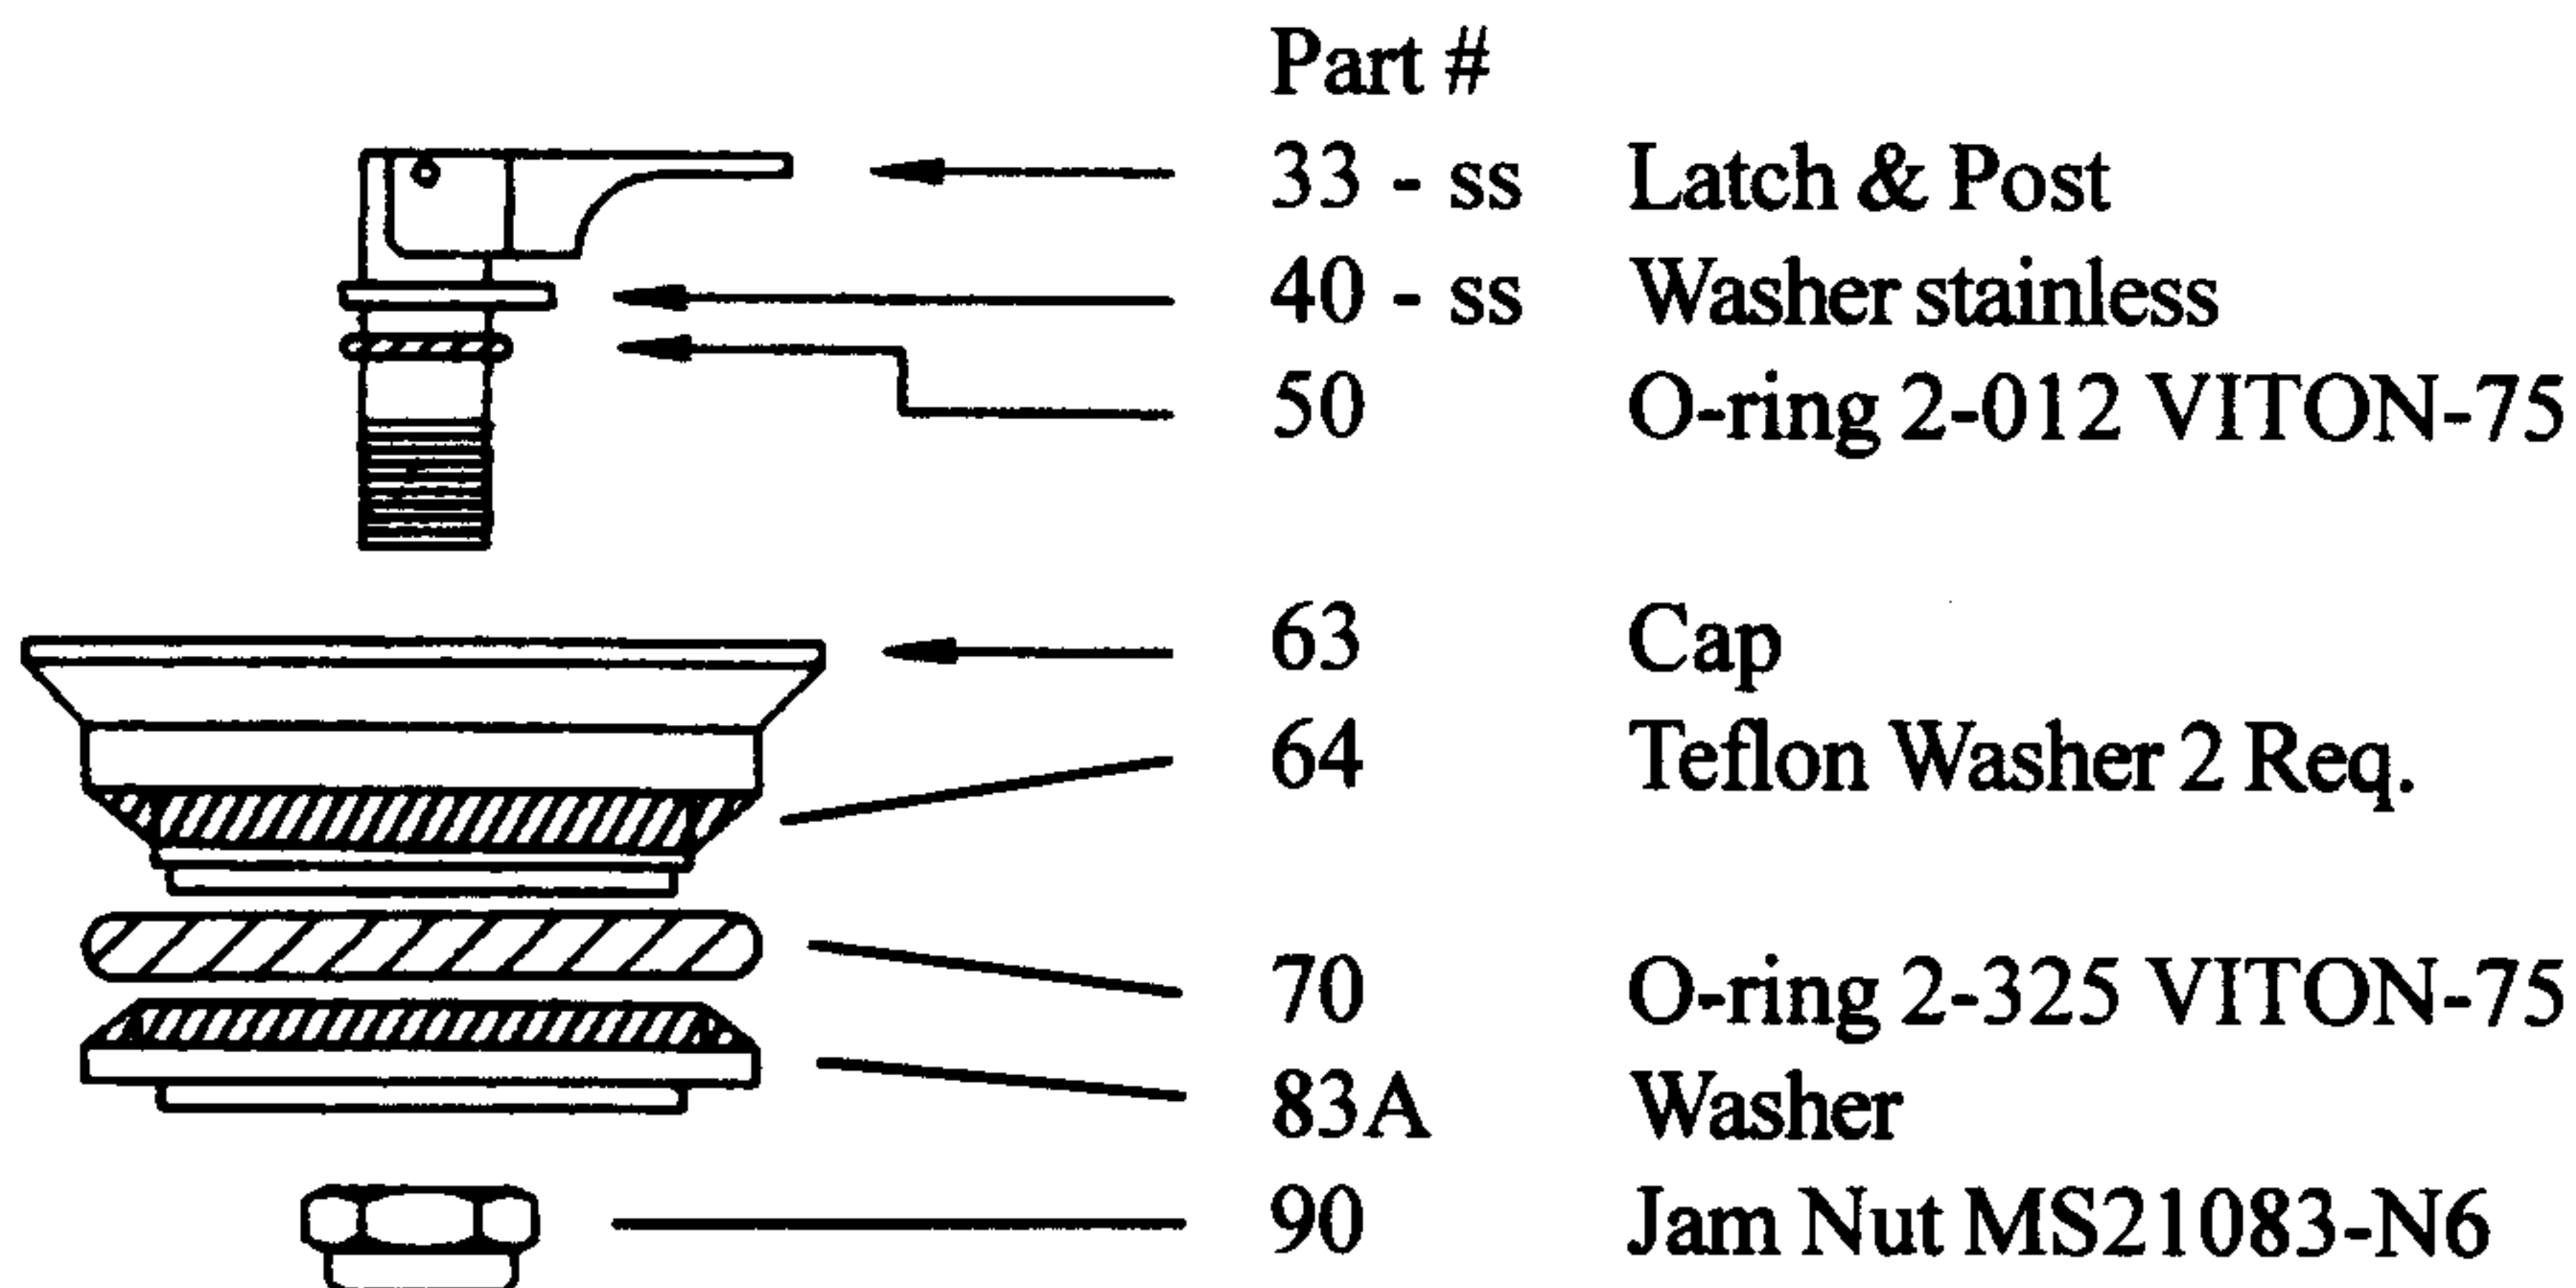

USHER ENTERPRISES, INC

9865 NW 307TH AVE., P.O. BOX 511

NORTH PLAINS, OR 97133

(503) 647-0015 FAX: (503) 647 - 1015

E-mail: usher@acsip.com

Name _____

Address _____

City / State / Zip _____


Phone # (____) _____

UD-3 FUEL CAP ORDER FORM

Please make checks payable to :
Usher Enterprises Inc.
Mail to the above address.

Part#	Description	Quantity Ordered	Unit Price	Total Price
UD-3	Cap with Adapter Flange		\$42.00	
UD-3Cap	Cap only		\$34.00	
UD-3Ad	Adapter Flange		\$18.00	

REPLACEMENT PARTS

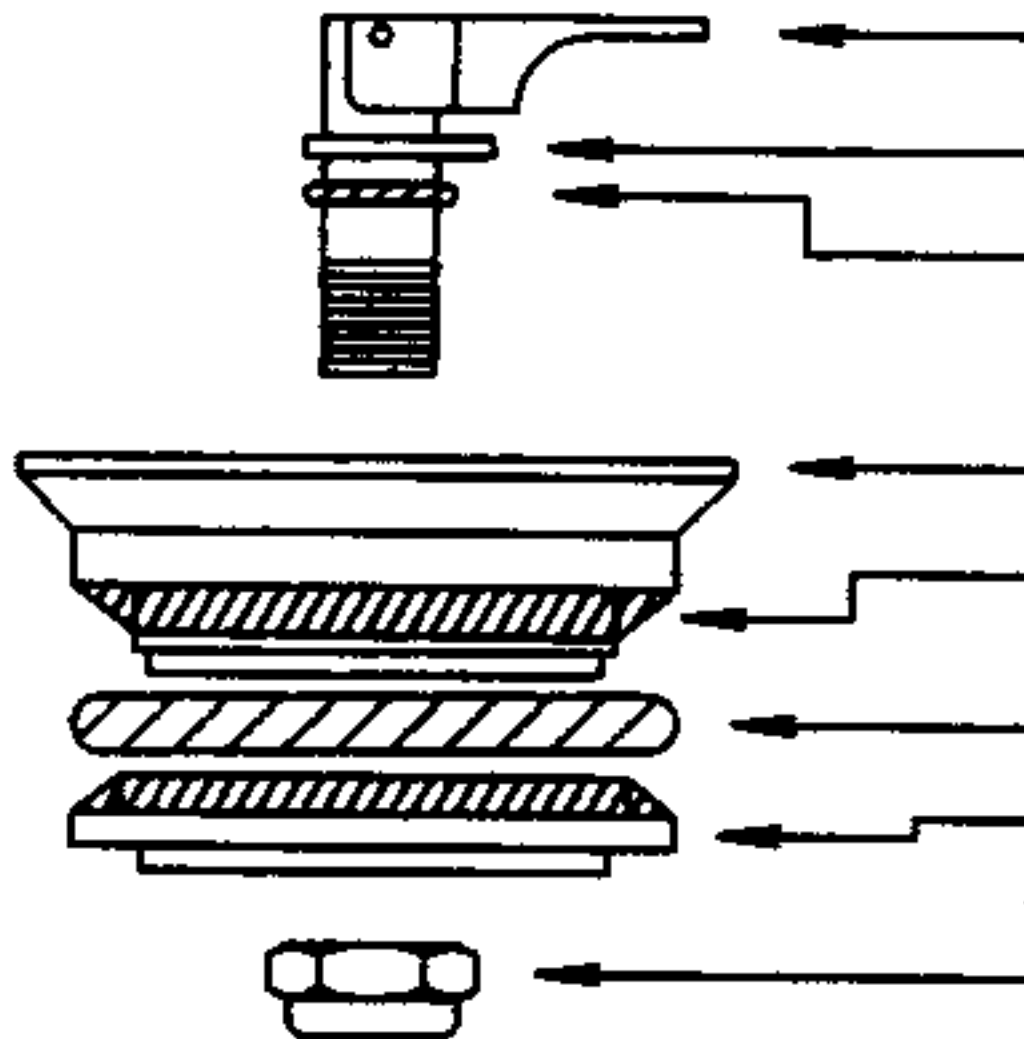

33-ss	Latch and Post		\$12.00	
40-ss	Washer Stainless		\$1.50	
50	O-ring 2-012 VITON-75		\$1.00	
63	Cap Casting		\$12.50	
70	O-ring 2-325 VITON-75		\$2.00	
83A	Washer Casting		\$8.00	
90	JAM Nut MS21083-N6		\$.75	
Shipping and Handling				\$3.00
Total Cost				